


# SUPERMAX® PUMP

## REPLACEMENT PARTS

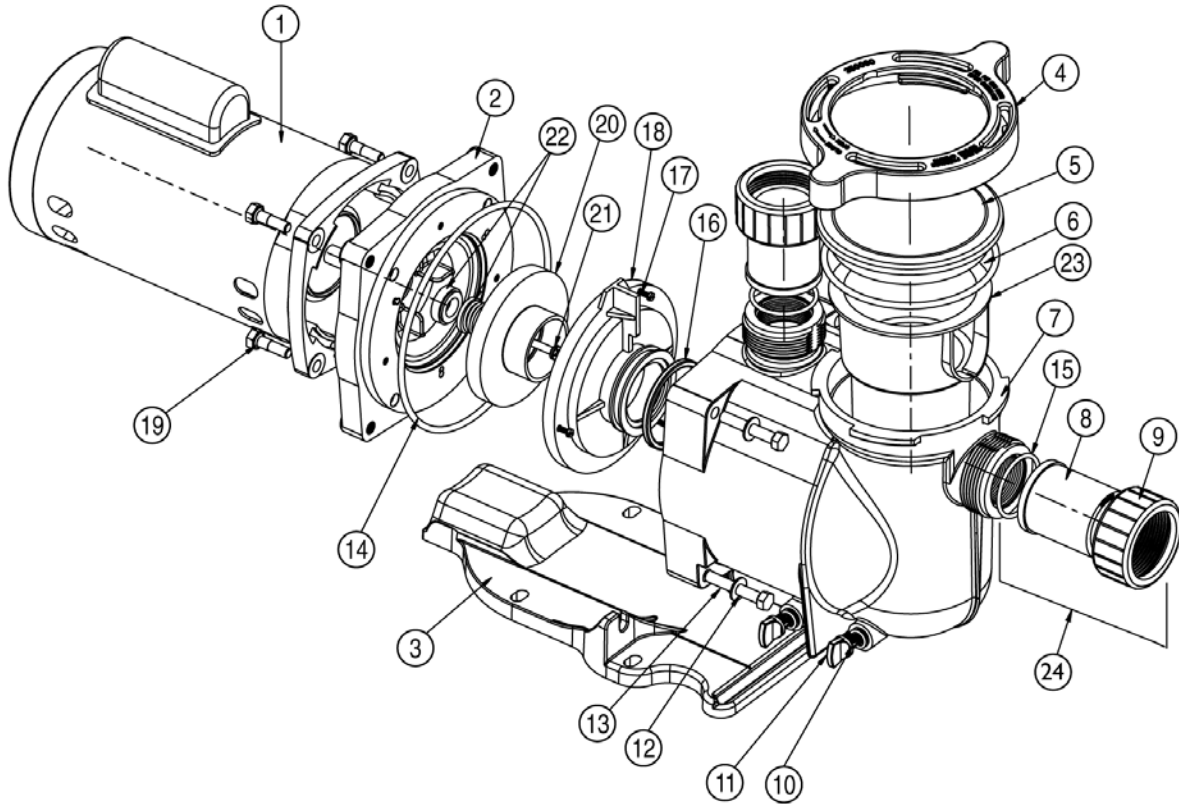

**Note:** Pumps and replacement motors that are single speed and one (1) total HP or greater cannot be sold, offered for sale, or installed in a residential pool for filtration use in California, Title 20 CCR sections 1601-1609.

CALIFORNIA PROPOSITION 65 WARNING  
 ⚠️ **WARNING:** Cancer and Reproductive Harm.  
 ⚠️ **AVERTISSEMENT:** Peut Causer le Cancer et des Dommages au Système Reproducteur.  
 ⚠️ **ADVERTENCIA:** Cáncer y Daño Reproductivo.  
[www.p65warnings.ca.gov](http://www.p65warnings.ca.gov) P650174A

# SUPERMAX® PUMP (CONT'D)

## REPLACEMENT PARTS

Item	Part No.	Description
<b>SINGLE SPEED SUPERMAX MOTORS</b>		
1	354804S	3/4HP, 1SP, 1PH, TEFC, 115/208-230
1	354822S	1HP, 1SP, 1PH, TEFC, 115/208-230
1	354824S	1-1/2HP, 1SP, 1PH, TEFC, 208-230
1	354816S	2HP, 1SP, 1PH, TEFC, 208-230
1	355019S	1/2 HP Motor, SQFL, 1 sp, 1 ph, 60 hz, 115/208-230, Black
1	355019S	3/4 HP Motor, SQFL, 1 sp, 1 ph, 60 hz, 115/208-230, Black
1	355021S	1 HP Motor, SQFL, 1 sp, 1 ph, 60 hz, 2115/208-230, Black
1	355023S	1-1/2 HP Motor, SQFL, 1 sp, 1 ph, 60 hz, 115/208-230, black
1	355025S	2 HP Motor, SQFL, 1 sp, 1 ph, 60 hz, 115/208-230, Black
1	355027S	2-1/2 HP Motor, SQFL, 1 sp, 1 ph, 60 hz, 208-230, Black
<b>2 SPEED SUPERMAX MOTORS</b>		
1	355232S	1 HP Motor, SQFL, 2 sp, 1 ph, 60 hz, 230V, Black
1	355376S	1-1/2 HP Motor, SQFL, 2 sp, 1 ph, 60 hz, 230V, Black
1	355377S	2 HP Motor, SQFL, 2 sp, 1 ph, 60 hz, 230V, Black
<b>EFFICIENT SUPERMAX MOTORS</b>		
1	355009S	1/2 HP Motor SQFL, 1 Speed, 1 phase, 60 Hz, 115/208-230, black
1	355009S	3/4 HP Motor SQFL, 1 Speed, 1 phase, 60 Hz, 115/208-230, black
1	355009S	1 HP Motor SQFL, 1 Speed, 1 phase, 60 Hz, 115/208-230, black
1	355011S	1.5 HP Motor SQFL, 1 Speed, 1 phase, 60 Hz, 115/208-230, black
1	355013S	2 HP Motor SQFL, 1 Speed, 1 phase, 60 Hz, 208-230, black
1	355015S	2.5 HP Motor SQFL, 1 Speed, 1 phase, 60 Hz, 208-230, black
<b>SUPERMAX PUMPS</b>		
2	355612	Seal Plate, Black
3	351094	Base, Black
4	351090	Clamp, Ramp & Cam, Black
5	350091	Lid
6	357255Z	O-ring, Lid #2-357
7	351089	Volute, Black
8	350093	Adapter, 2 req.
9	270141	Nut, 2 req.

Item	Part No.	Description
10	192115Z	O-Ring Drain Plug, 2 req.
11	357161Z	Drain Plug, 2 req.
12	355621	ScREW 3/4-16 x 2-1/4 HEX HD, 4 req.
13	072184	Washer 3/8 in. S/S, 4 req.
14	355619Z	O-Ring Seal Bracket
15	6020018	O-Ring Adapter #2-226, 2 req.
16	355030Z	Seal Diffuser
17	355334Z	Screw #8-32 HEX Washer HD, 3 req.
22	354545S	Seal Set
	356210S	Seal, mechanical, ozone/salt resistant
23	355667	Basket, Large
24	351157	SuperMax Union Kit (includes 2 of Items 8, 9, & 15)
<b>SUPERMAX DIFFUSERS</b>		
18	355617	Diffuser, 1/2 HP
18	355617	Diffuser, 3/4 HP
18	355617	Diffuser, 1 HP
18	355618	Diffuser, 1-1/2 HP
18	355618	Diffuser, 2 HP
18	350170	Diffuser, 2-1/2 HP
19	070429Z	Bolt, 3/8-16 X 7/8 SS Hex Head 18-8, 4 req.
<b>SUPERMAX IMPELLERS</b>		
20	355043	Impeller 1/2 HP
20	355043	Impeller 3/4 HP
20	355067	Impeller 1 HP
20	355074	Impeller 1-1/2 HP
20	355086	Impeller 2 HP
20	355093	Impeller 2-1/2 HP
20	355067	Impeller 1 HP, 2-SPD
20	355074	Impeller 1-1/2 HP, 2-SPD
20	355086	Impeller 2 HP, 2-SPD
21	355389	Screw, Impeller Locking
<b>NOT SHOWN</b>		
	79129900	2-Speed Toggle Switch
	401014Z	Motor End Cap and Screw
	357924Z	Fan Guard Kit TEFC/Super-Duty

CALIFORNIA PROPOSITION 65 WARNING  
 ⚠️ WARNING: Cancer and Reproductive Harm.  
 ⚠️ AVERTISSEMENT: Peut Causer le Cancer et des Dommages au Système Reproducteur.  
 ⚠️ ADVERTENCIA: Cáncer y Daño Reproductivo.  
[www.p65warnings.ca.gov](http://www.p65warnings.ca.gov) PH20211A